

September 24, 2012

Submitted to *Engineering Geology*

Title:

The internal structure of a rockslide dam induced by the 2008 Wenchuan (M_w 7.9) earthquake, China

Authors: Gonghui Wang, Runqiu Huang, Toshitaka Kamai, Fanyu Zhang

Addresses of authors:

Gonghui Wang, Assistant Professor (Corresponding author)

Research Center on Landslides

Disaster Prevention Research Institute

Kyoto University

Gokasho, Uji, 611-0011

Japan

Tel: (+81)774-384114; Fax:(+81)774-384300

e-mail: wanggh@landslide.dpri.kyoto-u.ac.jp

Runqiu Huang, Professor

State Key Laboratory of Geo-hazard Prevention and Geo-environment Protection

Chengdu University of Technology

Chengdu, Sichuan 610059

P.R. China

Toshitaka Kamai, Professor

Disaster Prevention Research Institute

Kyoto University

Gokasho, Uji, 611-0011

Japan

Fanyu Zhang, Dr.

Disaster Prevention Research Institute, Kyoto University, Japan

(Currently, School of Civil Engineering and Mechanics, Lanzhou University, Lanzhou, Gansu, P.R. China)

Abstract:

The internal structure of landslide dams plays a key role in their stability; however, it has not been much studied, probably due to the difficulty in obtaining information on internal structure in most cases. Here, we examined the shear-wave-velocity structure of a rockslide dam by a surface-wave technique called multichannel analysis of surface waves (MASW). During the 2008 Wenchuan earthquake ($M_w 7.9$), more than 60,000 landslides were triggered and 800 landslide dams formed. Those dams with a high risk of collapse threatened rescue activities, and almost all of the large landslide dams were treated by digging a sluiceway immediately after the earthquake. Although the risk of collapse of many landslide dams was removed or lowered, not all of the countermeasures were based on well controlled methods. To analyze the internal of landslide dams to assist in carrying out reliable countermeasures, we made detailed investigations on some of the dams, and here describe one landslide dam that occurred in the Tianchi area. Grain-size analysis revealed that the displaced landslide materials experienced fragmentation and segregation during the long movement. The shear-wave-velocity profile of the dam revealed that the dam consisted of three facies (carapace, body and basal facies). The boundary between facies is distinct. The body facies had a greater shear-wave velocity (compared to those landslide dams that had suffered collapse failure during the construction of a sluiceway), showing that the dam consisted of more densely deposited materials. This kind of dam body had a lower permeability, capable of retarding seepage that triggers collapse failure of the dam body due to piping. Big blocks on the surface also enabled the dam body to have greater resistance to overflow and thus reducing possible collapse failure in the immediate aftermath of overtopping.

Key Words: Landslide dam, 2008 Wenchuan earthquake, internal structure, stability of landslide dam, grain size distribution

57 Introduction

58 Landslide dams form when large landslides block river flows, forming lakes. Landslide dams formed by
59 such mass movements are often weak in structure, and can fail under their own weight or by overtopping.
60 Sometimes the released water carrying landslide debris causes fatalities and substantial damage to properties
61 downstream. For example, a landslide dammed Dadu River in an earthquake in Sichuan Province in 1786. Ten
62 days later, the dam failed, resulting in a devastating flood that reached 1400 km downstream, killing about
63 100,000 people (Li et al., 1986).

64 In recent years, many landslide dams triggered by earthquakes and rainfall have been reported. They often
65 cause great difficulties to the recovery phases in the hazard areas, and also threaten the safety of people living
66 downstream. It is normally required to make a risk assessment of the stability of the dam within a short time
67 immediately after the dam's formation (Tabatake et al. 2002). Two different approaches, the topographical
68 approach (Costa & Schuster 1988, 1991; Casagli & Ermini 1999; Ermini & Casagli, 2003; Korup, 2002, 2004)
69 and the hydraulic approach (Mizuyama et al, 1987, 1989; Takahashi and Kuang, 1988; Takahashi and Nakagawa,
70 1993), have been developed to analyze the possible longevity of the dam and the flood profile when the dam is
71 breached. The topographical characteristics and the breaching failure mechanisms due to overtopping have been
72 widely examined. Nevertheless, our understanding of the formation of landslide dams is still poor; so many
73 countermeasures for dealing with some giant landslide dams are empirically based. Normally, a landslide dam
74 consists of heterogeneous displaced debris, with properties determined by the locality as well as by the
75 movement of the landslide itself. Hence, in many cases, although the risk of dam breaching has been
76 acknowledged and understood, there are still cases in which the dam has collapsed while countermeasures were
77 being carried out. For example, in 2000, a giant rock avalanche formed a large landslide dam in the Yigong area,
78 Tibet, China, and the main countermeasure was digging a sluiceway. However, the dam collapsed suddenly after
79 the sluiceway was finished, resulting in severe downstream flooding, killing about 100 people downstream, and
80 resulting in 5,000 people losing their homes (Zhu et al., 2003). Although this kind of catastrophic failure had
81 occurred previously, the countermeasures for the Tangjiashan landslide dam formed in the 2008 Wenchuan

earthquake in Sichuan, China (dam height: about 100 m; dam volume: about 24 Mm³; storage capacity of dammed lake: about 320 Mm³) was also the construction of a spillway across the dam. Abrupt breaching occurred due to rapid erosion at the dam site, and a great flood threatened the cities downstream, such as Beichuan and Mianyang (Liu et al., 2009). Fortunately, only 1/3 of the dam height was breached, and 2/3 of the dam height remained stable, preventing the release of the entire reservoir of water. On the other hand, some hundreds of tonnes of dynamite were used on another landslide dam (formed during the 2008 Wenchuan earthquake), in an attempt to make a spillway by blasting to lower the risk of an outburst flood in case the dam breached abruptly. However, the explosion only functioned to break the big rocks, and the landslide dam itself was stable enough. From these cases, we can conclude that a proper approach for analyzing whether a landslide dam is stable or not has not been set up from an engineering viewpoint.

During the 2008 Wenchuan (M_w 7.9) earthquake, more than 90,000 people were killed due to the collapse of houses or landslides. The earthquake triggered 40 – 60 thousand landslides (Huang, 2009; Dai et al., 2011; Gorum et al., 2011) and more than 800 landslide dams were formed (Fan et al., 2012), greatly hindering recovery and reconstruction in the seismic hazard area. Almost all of the landslide dams failed naturally or were removed artificially soon after the earthquake. However, some of the larger landslide dams still remain, impounding large volumes of water, so there is still a major risk of outburst flooding. Therefore, it is of great importance to develop a fast and effective method to assess the risk of outburst flooding due to landslide dam failure.

To assist in assessing the risk of outburst flooding due to landslide dam failure, we carried out detailed field surveys of some of the big landslide dams formed during the 2008 Wenchuan earthquake, investigating the geological and topographical characteristics of the landslides, their processes of formation and the internal structure of the landslide dams. In this paper, through study of the landslide dam formed in Tianchi Town, Mianzhu City, we examine the formation of a landslide dam resulting from a long-travel rockslide occurring in a carbonate rock area. We surveyed the internal structure of the dam site by means of a multiple-channel surface-wave technique, and also analyzed the grain size distribution at the dam site. Based on the survey results, we discuss the dam's formation and stability. Fig. 1 shows the epicenter the 2008 Wenchuan earthquake, the

locations of landslides and the location of the Tianchi landslide dam.

2. Wenchuan earthquake and landslide dams

On May 12, 2008, at 14:28 hr local time, an earthquake ($M_w 7.9$), with a hypocentre at 30.99°N, 103.36°E, at a depth of 19 km occurred in Sichuan province, China (USGS, 2008). This is known as the Wenchuan earthquake, named after the earthquake's epicenter in Wenchuan County (Fig. 1). The maximum ground acceleration recorded during the earthquake was at Wolong, 18 km WNW of the epicenter. Peak accelerations there were 957.7 gal in the East-West direction, 652.9 gal in the North-South direction, and 948.1 gal vertically (Li *et al.*, 2008). The earthquake was felt as far away as Beijing (1500 km away) and Shanghai (1700 km away), and also in some nearby countries. Strong aftershocks continued to hit the area months after the main quake, causing further casualties and damage.

The 2008 Wenchuan earthquake occurred in the Longmen Shan thrust zone, which is located on the eastern boundary area of the Tibetan plateau. The Longmen Shan thrust zone is one of the most significantly deformed regions in China, with many seismically active faults (Burchfiel *et al.*, 1995, 2008; Jia *et al.*, 2006, 2007; Densmore *et al.*, 2007). The thrust zone is about 60 km wide, and marks the topographic boundary between the eastern Tibetan Plateau and the Sichuan basin. The convergence rate across the thrust zone is inferred to be 4-6 mm/yr (Deng *et al.*, 1994). Earthquakes occur frequently along this zone. In 1933, a M7.5 earthquake occurred in Diexi, 50 km northeast of Wenchuan. During this earthquake, some large lakes were formed behind landslide dams, and 6800 people were killed (about 2500 people were directly killed by the floods that followed collapse of two landslide dams). In 1976, two earthquakes (M7.2) occurred in Songpan and Pingwu, northeast of Chengdu.

In the Wenchuan earthquake area, the rocks in the vicinity of the Longmen Shan thrust zone are mainly composed of Triassic granite, metamorphosed sandstone, phyllite, sandy slate and dolomite (Ma, 2002). The rocks are closely jointed due to strong tectonic movement in this area. The adjacent Chengdu basin has been less affected by tectonic activity and remained relatively stable throughout the Cenozoic; here the strata of Jurassic

and Cretaceous age are covered by Quaternary alluvium (Ma, 2002).

The earthquake formed more than 800 landslide dams (Fan et al., 2012), of which 104 had heights of >10 m, impounding >10,000 m³ of water, and with catchment areas >20 km². Based on the scale of the landslide dam, the possible peak value of outburst flooding after breaching, and the possible downstream flooding area, the degree of risk of each landslide dam was placed into one of three risk categories (high, medium and low). Of the landslide dams, 6 were at high risk, 25 were at medium risk and 72 were at low risk (Liu, 2008; Yin, 2008). Emergency treatment measures had been carried on many of the landslide dams. The emergency work on the Tangjiashan landslide dam was reported worldwide and attracted wide concern.

3. Landslide dam in the Tianchi area

The landslide dam in Tianchi town (hereinafter called the Tianchi landslide dam) (Fig. 2), about 100 km north of Chengdu, resulted from a rock avalanche occurring on the right slope of a tributary of the Mianyuan River in Mianzhu City. Fig. 2a shows a satellite image of the landslide area taken before the earthquake. Figs. 2b and 2c present an oblique view of the whole dam site and a view from upstream. Fig. 2d shows a view of the dam from downstream, in which the piping is marked by a circle. From the Google Earth image and field investigation, we inferred that there was an unstable rock at the source area before the earthquake (marked as 'Unstable block' in Fig. 2a). The geological setting of the Tianchi area is presented in Fig. 3. The landslide area consists of Devonian clastics and carbonate (dolomite or dolomitic limestone). Bedding planes and joints of the bed rock in the source area were surveyed and are shown in Fig. 4, and they can be mainly divided into 5 groups. The bedrock of the source area was fractured by these bedding planes and joints, and a big unstable wedge was formed on the bedrock near the mountain ridge (Fig.4a). This unstable wedge failed during the earthquake, and traveled downslope rapidly (~28.5 m/s, Wang et al., 2011), burying the river channel, and climbing the slope of the opposite bank. A landslide dam was formed, with a dam height of 34–41 m, a length (along the river channel) of 158 m, and a width (across the river channel) of 70–102 m. The city hall, elementary school, and some houses on the upstream side were flooded by the impounded water. Fig. 5 shows the cross section along line I-I' shown

in Fig. 2a. For the cross section in Fig. 5, the topography after the quake was measured by a laser measuring technique (Trupulse360), while the topography before the quake was inferred from maps and field investigation.

The landslide dam is located on a tributary of the Miyuan River. The local engineers thought that the landslide dam was formed by big rock blocks, because the surface is covered by big rocks up to 6 m. Water flows from the lower part of the landslide dam on the downstream side, and the water level of the barrier lake was almost constant.

No engineering work was undertaken on the Tianchi landslide dam for about one and half years after the earthquake. Thereafter, following the need for recovery and reconstruction work upstream of the landslide dam, a spillway was dug in the dam gradually by steps. Finally, the dam was excavated to the level of the river bed before the earthquake. Fig. 6 shows the status of excavation of the channel at different times (Fig.6a on June, 2010). The channel had been excavated in three steps at the time of our first survey, and had reached the original bed river at the time of our second survey (June, 2010). The progressive channel excavation enabled us to perform a geophysical survey using a surface wave technique called the multichannel analysis of surface waves (MASW) and also carry out grain-size-distribution analysis of the soil layers in the dam at different depths.

4 Internal structure of the landslide dam

4.1 Grain-size distribution

The surface of Tianchi landslide dam was almost completely covered by very large boulders (c. 2–6 m in diameter). Observations of the soil layers in the dam exposed as channel construction progressed revealed that the boulders were mostly in the surficial soil layer; immediately below the surficial layer were small boulders (< 0.5 m), gravels and finer debris. To analyze the grain-size distribution of soil layers at different depths within the dam, we analyzed grain size by sieving and photography. The reliability of this combined method for grain size distribution analysis has been verified by Casagli et al (2003). We performed the analysis by following steps.

(1) The area ratio of grains with $\phi > 40\text{mm}$ was measured by means of particle digital image analysis. Due to the progressive excavation of the channel, soil layers at different depths were exposed. We sampled 11 points at

different soil layer levels, reshaping the face locally to be vertical. Two orthogonally oriented scales were put on the vertical surface, and photographs were taken.

(2) For the target measuring area, the area ratios of grains with differing sizes were calculated by photographic analysis. After taking the photo, the grain in each photograph was outlined by drawing a line along its boundary. Using the outlined figure, the diameter (the diameter of the inscribing circle of the outline) and the cross section area of each grain were calculated, and the total cross section area of grains with the same diameter was then calculated. Considering the possibility of human error in drawing the outlines of grains, we used a photographic analysis method to analyze the larger grains with $\phi > 4.75\text{mm}$.

(3) We took samples from the surface of the photographed area, sieved out those gravels with $\phi > 50\text{ mm}$, and took 10 kg of samples ($\phi \leq 50\text{ mm}$) to the laboratory for further grain size analysis by sieving following the ASTM standard.

(4) The percentages of grains with different grain sizes were calculated. Assuming that the debris has the same density, the percentages by weight of grains with differing sizes were calculated through the area ratio (obtained by particle digital image analysis) of different grains and the results from sieving analysis.

We sampled 11 locations for the distribution of grain size in the Tianchi landslide dam (Fig. 6a). Samples P1 – P8 were taken on November 2009, and P9 – P11 on June 2012. P1 – P4 and P8 are located on the upper steps along the road, P5 – P7 are on the side slope of the excavation at level L3. P9 – P11 are located at the bottom of the excavation (about 2 m above the outcropping former river bed). P9 is near the downstream margin of the landslide dam, while P10 is below P7, and P11 is below P5. Fig. 7 presents the grain-size distributions. Because very large boulders were located only in the surficial layer, there were no grains $> 50\text{cm}$ in Fig. 7. From the grain size distribution of P1 – P4, and P8 (Fig. 7a), we saw that the grains tended to become coarser closer to the lateral margins (say, P8 and P9). This tendency is normal in the deposits of large-scale rock avalanches (Schulz et al., 2008; Crosta et al., 2011; Davis and McSaveney, 2011; Dunning and Armitage 2011), due to the segregation of grains during movement. Nevertheless, a similar tendency was missing in the grain-size distribution of P5 – P7 (Fig. 7b). This may result from the facts that P5 – P7 were located in the deeper soil

layers of the dam site, and the distance between them was relatively short.

4.2 Shear-wave velocity profile of the landslide dam

To investigate the internal structure of the landslide dam, we used a surface-wave method known as multichannel analysis of surface waves (MASW) (Park et al., 1999; Hayashi and Suzuki, 2004) to measure the shear-wave velocity profile of the landslide-dam site. The survey principle of MASW and the layout of equipment (Seismograph: Model McSEIS-SXW, OYO Corporation, Tokyo, Japan; Geophones: Model GS-11D, OYO Geospace Corporation, Houston, Texas, USA) are outlined in Fig. 8. In the survey, 24 geophones were spaced at 2 m intervals along a line. A wooden hammer (about 8 kg) was used as the seismic motion exciter. The hammer points were outside of both ends of the survey line and also intermediate between the geophones. We carried out our first survey in November 2009, when the landslide dam had been excavated with the shape shown in Fig. 6b. The landslide dam excavation had three steps (L1, L2 and L3), with the most upper one (L1) along the original road before the earthquake and exposed during the excavation. Step L3 (shown by dashed line) was flat at the time of our survey, although it was later dug deeper as excavation progressed. In June of 2010, we surveyed this area again, when the excavation had been finished, and the bottom of the excavation had reached almost to the original river bed level (L4). Hereinafter, we call these survey lines L1, L2, L3, and L4, respectively. Fig. 9 show the shear-wave velocity profile along survey line L1, and Fig.10 along survey lines L2 to L4. As mentioned above, L1 is along the original road. The shear-wave velocity values obtained along this line thus represent those of the slope before the earthquake. As shown in Fig. 9, most of the field has shear-wave velocity values ranging from 400–480 m/s. However, around 30 m from the beginning point and at a depth of 9 m, shear-wave velocity values are smaller (ranging from 350–400m/s). This field of smaller shear-wave velocity values might reflect the former channel of the stream, i.e., landslide debris buried the stream path, with the soil layer deposited being looser than the surrounding original mountain slope.

Survey line L2 was along the newly built road. Due to the construction of the road, a 3–5m thick soil layer had been excavated (Fig. 6b). In L2, the whole surficial layer (about 6 m deep) and all soil layers (from the

surface to the bottom) 0–30 m from the upstream end of the line had relatively smaller shear-wave velocity values (330–390 m/s) (Fig. 10a). Most of the soil layer along L3 showed greater shear-wave velocity values (400 m/s–480 m/s) (Fig. 10b). However, the domain on the middle part of the survey line (30–60m) and 7–10m deep had relatively smaller shear-wave velocity values (330m/s–400m/s). Although the grain size of the soil layer near this area was not measured, from the grain size distribution of the surficial soil layers in L3 (P5–P7 in Fig. 7b), we can infer that the effective grain size (D_{10}) tended to become smaller. If it is assumed that the soil density is everywhere constant, the rigidity modulus becomes smaller with decrease of gravel content. Because the shear-wave velocity $V_s = \sqrt{\frac{G}{\rho}}$ (G : Rigidity modulus; ρ : mass of soil layer), the smaller the rigidity modulus is, the smaller the shear-wave velocity becomes. Therefore, we infer that the area with smaller shear-wave velocity (shown in the ellipsoidal area) might result from a segregation phenomenon as shown in Fig. 7. Due to the segregation process during movement, finer debris accumulated in this area, forming soil layers that are relatively weaker than the surrounding domain. The soil layer below line L4 showed high shear-wave velocity values (400 m/s–480 m/s) in general, with a small area with relative low shear-wave velocities (330–390 m/s). However, the soil layer near the bottom (the original river bed) showed lower shear-wave velocities (250–300m/s). This may partially result from the original fluvial river-channel deposits and also the entrained substrate mixed with rockslide debris.

5. Discussion

It has been noted that breaching of landslide dams normally results from three types of failure processes (Takahashi and Kuang, 1988), i.e., overtopping erosion, occurrence of slides on the whole dam, and progressive failure. It has also been noted that overtopping breaching is dominant in breached landslide dams, and that progressive dam failure due to seepage (piping flow) is rare (Mizuyama et al., 1987, 1989). However, of the 32 big landslide dams that formed during the 2008 Wenchuan (M_w 7.9) earthquake and had engineered channels excavated in them, 8 failed from piping flow (Xu et al. 2009). Thus, in the case of the Wenchuan earthquake, piping-triggered catastrophic breaching of landslide dam was not rare. Furthermore, many of the landslide dams

that consisted of finer grained debris of sand and gravels suffered breaching due to overtopping erosion. On the other hand, landslide dams consisting of coarser materials (such as gravels and huge boulders) showed greater stability (Chigira et al., 2010; Wang, 2011).

For longevity analysis of landslide dams, an approach termed the *Dimensionless Blockage Index (DBI)* has been proposed by Ermini and Casagli (2003).

$$DBI = \log (A_b H_d / V_d) \quad (1)$$

where A_b is area of the catchment (km^2); H_d is height of the landslide dam (m) ; V_d is volume of the landslide dam ($\times 10^6 \text{ m}^3$). Based on the analysis of many recorded landslide dams all over the world, Ermini and Casagli (2003) recognized three “stability domains” for the dimensionless blockage index (1) when $DBI < 2.75$, the landslide dam lies in the stability domain; (2) when $2.75 < DBI < 3.08$, the landslide dam is in the uncertain domain; and (3) when $DBI > 3.08$, the landslide dam is in the instability domain.

For Tianchi landslide dam, its length is about 158 m, width 70–102 m, and height 34–41 m, the upstream catchment area is about 30.83 km^2 . Equation 1 indicated a *Dimensionless Blockage Index* value of 3.72. Hence, Tianchi landslide dam could be regarded to lie in the instability domain. However, no breaching occurred before the channel was excavated. This suggested that the landslide dam itself was stable. It is noted that during the channel excavation on some other large landslide dams formed in the same earthquake in Sichuan, such as Tangjiashan, Xiaojiaqiao, and Xiaogangjian, etc, abrupt dam breaching occurred, resulting in catastrophic flooding downstream. In Fig. 11, we superimposed the plot of catchment area against V_d / H_d together with those obtained by Ermini & Casagli (2003), where SD means the stability domain, UD instability domain. The risk of abrupt breaching of some large landslide dams formed in the 2008 Wenchuan earthquake is correctly indicated by the Dimensionless Blockage Index, with the exception of the Tianchi landslide dam. This may be due to the fact that the Dimensionless Blockage Index is based on topographic features of the landslide dam and the upstream catchment area, without consideration of the dam’s geotechnical properties. Such anomalous behavior has also been reported by Strom (2010), who suggests that additional quantitative parameters characterizing landslide dams and dammed lakes should be used in the stability analysis of landslide dams. However, although

the geotechnical properties of landslide dams play a key role in dam stability and also in the resistance to overtopping erosion, they have been rarely incorporated before now, probably due to the difficulties in obtaining them.

We surveyed the shear-wave velocity profiles of several large landslide dams formed in the 2008 Wenchuan earthquake, and found that those dams that abruptly breached during the construction of the sluiceway had shear-wave velocity values smaller than 250 m/s (Wang, 2011). It is known that the standard penetration test N value of a soil layer has a positive correlation with the shear-wave velocity (Imai and Tonouchi, 1982). A higher shear-wave velocity value means that the soil layer has greater penetration resistance, indicating that the soil layer is more tightly consolidated. From Fig. 10 we can see that almost all the domains of Tianchi landslide dam have greater shear-wave velocity values (say, >300 m/s). Therefore, we conclude that the landslide dam is in a tightly consolidated state, so no abrupt breaching could occur during the discharge of impounded water after the channel excavation was finished. The greater shear-wave velocities may be due to the fact that the landslide debris with high mobility rushed into the river valley, and was deposited there suddenly, leading to the debris being tightly consolidated. Such tightly consolidated landslide dams may be less likely to experience slides compared to loosely deposited landslide dams (Foster et al., 2000).

According to Dunning and Armitage (2011), rock-avalanche deposits generally exhibit three sedimentary facies: i.e., a carapace facies (the coarsest unit composing the surface and near surface), a body facies (the main body of the rock-avalanche deposit), and a basal facies (the base of the rock-avalanche deposit). The boundary between the basal facies and the body facies is often indistinct in the field. Our MSWA survey showed that these three facies were easily identified from the shear-wave velocity profile (Fig. 10). The carapace and basal facies have smaller shear-wave velocities, while the body facies occupying the main area of the deposits has greater shear-wave velocities. Therefore, the shear-wave velocity profile enables us to not only identify the distribution of these facies, but also to estimate the geotechnical properties of each facies.

Hydraulic prediction of downstream flooding due to failure of a landslide dam is of great importance to the assessment of potential damage downstream and effective evacuation. By now, some approaches to this kind of

hydraulic prediction have been proposed, based on experimental work on landslide dams consisting of homogenous soil layers. However, as revealed by the grain size distribution of Tianchi landslide dam, a landslide dam normally consists of heterogeneous debris. Therefore, in the analysis of a landslide dam formed by long-runout landslides, the sedimentary facies phenomenon should be considered. Especially in the analysis of breaching risk due to overtopping, the effects of very large boulders in the surficial layers should be taken into account. As in the case of the Tianchi landslide dam, the giant boulders ($\phi=2\sim6\text{m}$) of the surficial layer can elevate the resistance to overtopping erosion, and thus retard the occurrence of sudden breaching. On the other hand, as pointed by Dunning and Armitage (2011), the presence of a coarse layer (carapace facies) in the upper part of the landslide dam may enhance permeability, so that the upper layer may become saturated rapidly after overtopping, resulting in rapid breaching. However, the finer materials inside the landslide dam are tightly consolidated and can lower the seepage and lead to a lower water table in the downstream dam body. In this case, even if overtopping occurs, the soil layers in the downstream part of the dam may not be saturated quickly, so collapse failure may not occur.

It is noted that at present there is no accepted rapid approach to predict the stability of a landslide dam immediately after its formation. However, we expect that a method combining the Dimensionless Blockage Index and shear-wave velocity survey results could be developed so that the risk of abrupt breaching of a landslide dam can be assessed rapidly and more reliably. In the future, we plan to carry out similar geophysical surveys on more landslide dams with differing topographic, geological and movement characteristics to develop a physically based method of assessing the breaching risk of landslide dams.

6. Conclusions

To understand the formation and mechanisms allowing abrupt breaching of landslide dams that formed during the 2008 Wenchuan ($M_w7.9$) earthquake, a landslide dam that resulted from a long-runout rockslide in the Tianchi area was investigated. Based on geophysical surveys on the dam and grain-size analysis, the internal structure and the stability of this landslide dam were analyzed. The conclusions are as follows:

(1) Tianchi landslide resulted from the failure of an unstable rock block in the source area. The displaced landslide mass traveled a long distance, colliding with the opposite river bank, and damming the river. Because the bedding planes and the joints in the source area were well developed, the landslide debris consisted of many very large boulders.

(2) Segregation phenomenon occurred within the displaced debris. After a long distance of movement, the larger boulders formed surficial layer, the coarse carapace facies found on many rock avalanche deposits. The debris was much finer deeper within the landslide dam.

(3) A seismic geophysical survey of the landslide dam revealed that the soil layers inside the dam had greater shear-wave velocities in general (>330 m/s), and the landslide dam was not homogenous. The surficial layer (carapace facies) and the bottom layer (basal facies) have relatively smaller shear-wave velocities values. Some domains of the central part of the dam also show relatively smaller shear-wave velocities—namely, some relatively weaker layers are sandwiched in the landslide dam.

(4) Tianchi landslide dam was covered by huge boulders but consisted of tightly consolidated finer materials. This kind of dam structure can resist overtopping erosion and reduce the likely occurrence of piping, thus retarding breaching immediately after the occurrence of overtopping flow.

Last, it is noted that detailed seismic geophysical surveys on many other landslide dams are ongoing to understand the internal structure of landslide dams with differing geological and topographic backgrounds and differing movement mechanisms. The target landslide dams are those triggered by the 2008 Wenchuan earthquake in China, by the 2004 Niigata Prefecture Chuetsu earthquake in Niigata, Japan, and by heavy rainfall during the 2011 Typhoon Talas in Kii Peninsula, Japan. By doing so, we are expecting to enhance the reliability in the analysis of stability of landslide dam with help of shear-wave velocity profiles.

Acknowledgments :

This research was supported by the Opening Fund of State Key Laboratory of Geohazard Prevention and Geoenvironment Protection (Chengdu University of Technology) (Nos. SKLGP2011K012), a scientific research

357 grant from the MEXT of Japan (Grant No. 21403002), and a 2009 special event fund for promotion of disaster
358 prevention research, DPRI, Kyoto University (SA21-06). We are grateful to Dr. Wei Hu (Chengdu University of
359 Technology), Prof. Masahiro Chigira (Kyoto University), Prof. Xiyong Wu (Southwest Jiaotong University), Dr.
360 Fei Cai (Gunma University), Dr. Sergio Lourence (Cardiff University), and Dr. Murice McSaveney (GNS
361 Science, New Zealand), for their help and valuable discussions on this work. Valuable English editing by Dr.
362 Eileen McSaveney (GNS Science, New Zealand) is appreciated.

References

- Burchfiel, B.C., Chen, Z., Liu, Y., Royden, L.H., 1995. Tectonics of the Longmen Shan and adjacent regions, central China, *International Geological Review* 37, 661–735.
- Burchfiel, B.C., Royden, L.H., van der Hilst RD, Hager, B.H., 2008. A geological and geophysical context for the Wenchuan earthquake of 12 May 2008, Sichuan, People's Republic of China, *GSA Today* 18
- Casagli, N., Ermini, L., 1999. Geomorphic analysis of landslide dams in the northern Apennine. *Transactions of the Japanese Geomorphological Union* 20, 219– 249.
- Casagli, N., Ermini, L. Rosati G. 2003. Determining grain size distribution of the material composing landslide dams in the Northern Apennines: sampling and processing methods. *Engineering Geology*, 69(1-2): 83-97
- Chigira, M., Wu, X.Y., Inokuchi, T., Wang, G., 2010: Landslides induced by the 2008 Wenchuan earthquake, Sichuan, China. *Geomorphology*, 118(3-4.: 225-238.
- Costa, J.E., Schuster, R.L., 1988. The formation and failure of natural dams, *Geological Society of America Bulletin* 100, pp. 1054–1068
- Costa, J.E., Schuster, R.L., 1991. Documented historical landslide dams from around the world. *U.S. Geological Survey Open-File Report* 91-239, 1-486.
- Crosta, G.B., Frattini, P., Fusi, N., Sosio, R. 2011. Formation, characterization, and modeling of the Val Pola rock-avalanche dam (Italy). Chapter 12, in *Natural and Artificial Rockslide dams* (Evans, Hermanns, Strom, and Scarascia-Mugnozza, eds.), Springer, pp:347-368
- Dai, F.C., Xu, C., Yao, X., Xu, L., Tu, X.B. and Gong, Q.M., 2011. Spatial distribution of landslides triggered by the 2008 Ms 8.0 Wenchuan earthquake, China. *Journal of Asian Earth Sciences*, 40(4): 883-895
- Deng Q, Chen S, Zhao X., 1994. Tectonics, seismicity, and dynamics of the Longmen Shan Mountains and its adjacent regions, *Seismological Geology* 16: 389–403 (in Chinese)
- Densmore, A.L., Ellis, M.A., Li, Y., Zhou, R., Hancock, G.S., Richardson, N., 2007. Active tectonics of the Beichuan and Pengguan faults at the eastern margin of the Tibetan Plateau, *Tectonics* 26: TC4005

387 Dunning, S.A., Armitage, P.J., 2011. The grain-size distribution of rock-avalanche deposits: implications for
 388 natural dam stability. Chapter 19 in *Natural and Artificial Rockslide dams* (Evans, Hermanns, Strom, and
 389 Scarascia-Mugnozza, eds.), Springer, pp: 497-498.

390 Davies, T.R., McSaveney, M.J., 2011. Rock-avalanche size and runout – implications for landslide dams.
 391 Chapter 17 in *Natural and Artificial Rockslide dams* (Evans, Hermanns, Strom, and Scarascia-Mugnozza,
 392 eds.), Springer, pp: 441-462.

393 Ermini, L., Casagli, N., 2003. Prediction of the behaviour of landslide dams using a geomorphological
 394 dimensionless index. *Earth Surface Processes and Landforms*, 28(1): 31-47.

395 Fan, X., Gorum, T., Cees J. van Westen, Korup, O., Xu, Q., Dai, F., Huang, R., Wang, G., 2012. Transient water
 396 and sediment storage of the decaying landslide dams induced by the 2008 Wenchuan earthquake, China.
 397 *Geomorphology* 171-172: 58-68.

398 Foster, M.A., Fell, R., Spannangle, M., 2000. The statistics of embankment dam failures and accidents. *Canadian*
 399 *Geotechnical Journal* 37(5), 1000–1024.

400 Gorum, T., Fan, X.M., van Westen, C.J., Huang, R.Q., Xu, Q., Tang, C., Wang, G., 2011. Distribution pattern of
 401 earthquake-induced landslides triggered by the 12 May 2008 Wenchuan earthquake. *Geomorphology*
 402 133(3-4):152-167.

403 Hayashi, K., Suzuki, H., 2004. CMP cross-correlation analysis of multi-channel surface-wave data. *Explor.*
 404 *Geophys.*, 35 (2004), pp. 7–13

405 Huang, R.Q., 2009. *Geohazard assessment of the Wenchuan Earthquake*. Science Press, 944P (in Chinese)

406 Imai, T., Tonouchi, K., 1982. Correlation of N-value with S-wave velocity and shear modulus. *Proc. 2nd*
 407 *European Symp. Of Penetration Testing (Amsterdam)*, 57–72.

408 Jia, D., Wei, G., Chen, Z., Li, B., Zeng, Q., Yang, G., 2006. Longmen Shan fold-thrust belt and its relation to the
 409 western Sichuan Basin in central China: new insights from hydrocarbon exploration, *AAPG Bulletin* 90:
 410 1435–1447.

411 Jia, Q., Jia, D., Zhu, A., Chen, Z., Hu, Q., Luo, L., Zhang, Y., Li, Y. 2007. Active tectonics in the Longmen
 412 thrust belt to the eastern Qinghai–Plateau and Sichuan Basin: evidence from topography and seismicity,
 413 Chinese Journal of Geology 42: 31–44.

414 Korup, O., 2002. Recent research on landslide dams - a literature review with special attention to New Zealand,
 415 Progress in Physical Geography 26, 206-235.

416 Korup, O., 2004. Geomorphometric characteristics of New Zealand landslide dams. Engineering Geology 73,
 417 13–35

418 Li, H., Fu, X., Van Der Woerd, J., Si, J., Wang, Z., Hou, L., Qiu, Z., Li, N., Wu, F., Xu, Z., Tapponnier, P., 2008.
 419 Co-seismic surface rupture and dextral-slip oblique thrusting of the Ms 8.9 Wenchuan Earthquake. Acta
 420 Geologica Sinica 82, 1623–1643.

421 Li, T., Schuster, R.L., Wu, J., 1986. Landslide dams in south central China. In: Schuster, R.L. (Ed.), Landslide
 422 Dams Processes, Risk and Mitigation, Special Publication vol. 3. ASCE, pp. 146– 162.

423 Liu, N., 2008. Lesson from the countermeasures on lowering the risk of the dammed lakes formed by large
 424 landslides during the 2008 Wenchuan earthquake. Journal of China Water Resources 16,1-7 (in Chinese)

425 Liu N., Zhang J.X., Lin, W., Cheng W.Y., Chen Z.Y., 2009. Draining Tangjiashan barrier lake after Wenchuan
 426 earthquake and the flood propagation after the dam break. Science in China Series E: Technological
 427 Sciences, 52(4): 801-809.

428 Li, X., Zhou, Z., Yu, H., Wen, R., Lu, D., Huang, M., Zhou, Y., Cu, J., 2008. Strong motion observations and
 429 recordings from the great Wenchuan Earthquake. Earthquake Engineering and Engineering Vibration 7,
 430 235–246.

431 Ma LF (ed.). 2002. Geological atlas of China, Geological Publishing House, 348p

432 Mizuyama, T., Ishikawa, Y., Fukumoto, A., 1987. Landslide dams outburst due to seepage. Annual of Public
 433 Works Research Institute, Vol.2744, 18-91 (in Japanese).

434 Mizuyama, T., Ishikawa, Y., Fukumoto, A., 1989. Landslide dams outburst and its Countermeasure. Civil
 435 Engineering Journal, Vol.31-11; 50-56 (in Japanese).

436 Park, C.B., Miller, R.D., Xia, J., 1999. Multichannel analysis of surface waves. *Geophysics*, 64 (3), 800–808.

437 Schulz, W.H., Harp, E.L., Jibson, R.W., 2008. Characteristics of large rock avalanches triggered by the
 438 November 3, 2002 Denali Fault earthquake, Alaska, USA, Proc. 10th ISL, Xian, China, June 30-July 4, 2008,
 439 Taylor and Francis Group, London, 1447-1453.

440 Sherard, J.L., 1979. Sinkholes in dams of coarse, broadly graded soils, 13th ICOLD Congress, India, Vol. II, pp.
 441 25-35.

442 Strom, A., 2010. Landslide dams in Central Asia region. *Journal of the Japan Landslide Society* 47(6), 309-324.

443 Tabatake, S., Mizuyama T., Inoue, K., 2002. Landslide dam and hazards, Kokon Press, 205pp.

444 Takahashi, T., Kuang, S.F., 1988. Hydrograph prediction of debris flow due to failure of landslide dam. *Annals*,
 445 *Disas. Prev. Res. Inst., Kyoto Univ.*, No.31 B-2: 601-615.

446 Takahashi, T., Nakawaga H., 1993. Flood and Debris flow hydrograph due to collapse of a natural dam by
 447 overtopping. *Journal of Hydroscience and Hydraulic Engineering, JSCE*, 37: 699-704.

448 USGS, 2008. Website (<http://earthquake.usgs.gov/eqcenter/eqinthenews/2008/us2008ryan/>), accessed on
 449 September 17, 2012.

450 Wang, G., 2011. Formation of large scale landslide dams and failure prediction. *Proceedings of 2011 landslide*
 451 *symposium, Kansai Branch of Japan Landslide Society*, pp:65-80 (in Japanese).

452 Wang, Q., Wang, Y.S., Jiang, Y.A., Wei, P., Zhi, Z.Z., 2011. The initiation mechanism and movement process of
 453 Tianchi landslide. *Gansu Water Conservancy and Hydropower Technology* 47(1):16-18 (In Chinese).

454 Xu, Q., Fan, X.M., Huang, R.Q., Van Westen, C.J., 2009. Landslide dams triggered by the Wenchuan Earthquake,
 455 Sichuan Province, south west China. *Bull Eng Geol Environ* 68:373-386.

456 Yin, Y.P., 2008. Researches on the Geo-hazards triggered by Wenchuan Earthquake, Sichuan, *Journal of*
 457 *Engineering Geology* 16: 433-444 (in Chinese).

458 Zhu, P.Y., Wang, C.H., Wang Y.C., 2003. Large-scale landslide-debris avalanche in Tibet, China, (2) formation
 459 of an exceptionally serious outburst flood from a landslide dam in Tibet. *Landslide News, International*
 460 *newsletter of the Japan Landslide Society*, 14/15: 23-25.

Captions:

Fig. 1 Epicenter of the Sichuan earthquake, the distribution of landslides, and location of the Tianchi landslide dam (after Huang and Li, 2009).

Fig. 2 Landslide dam in the Tianchi area: (a) satellite image of landslide area before the quake; (b) view of the landslide from upstream of the dam after channel excavation (taken on March 19, 2011); (c) landslide dam and lake (Courtesy of F. Cai, taken on November 7, 2008 by F. Cai); (d) landslide dam viewed from downstream (Courtesy of F. Cai, taken on November 7, 2008)

Fig.3 Geological settings of the Tianchi area – 1: Stratum boundary; 2: Fault; 3: Tianchi landslide area; 4: Quaternary alluvial and diluvial deposit; 5: Triassic sandstone, conglomerate, siltstone and mudstone; 6: Triassic shale; 7: Triassic clastic rock and carbonate rock; 8: Permian shale, limestone and basalt; 9: Devonian sandstone and conglomerate with carbonate rock; 10: Devonian clastic rock and carbonate rock; 11: Silurian slate; 12: Cambrian shale, siltstone, mudstone and sandstone; 13: Cambrian dolomite; 14: Sinian dolomite and marble; 15: Proterozoic acid volcanic, clastic rock and carbonate rock; 16: Proterozoic granite; 17: Diabase dike (after Ma, 2002)

Fig. 4 (a) Source area of the landslide; (b) Stereonet plot of rock-mass discontinuities in the source area

Fig. 5 Longitudinal section along line I-I' in Fig. 2a

Fig. 6 (a) Photograph of landslide dam after excavation, with locations of shear-wave velocity survey lines and grain-size sampling points (P1–P11); (b) Cross section of the landslide dam at differing surveying times. L3, L4: spillway levels on November 20, 2009, and June 16, 2010, respectively.

Fig. 7 Grain size distributions of materials from dam body: (a) samples on the same altitude level, (b) samples at different depths within the dam body

Fig. 8 Measurement principle of multichannel analysis of surface waves (MASW).

491 Fig. 9 Shear-wave velocity profile along traverse line L1

492

493 Fig. 10 Shear-wave velocity profile of the dam body. (a), (b), (c): results for traverse line L2, L3 and L4,

494 respectively

495

496 Fig.11 Stability analysis using Dimensionless Blockage Index (after Ermini and Casagli (2003)) ▲ : intact

497 landslide dams; ◆:collapsed landslide dams

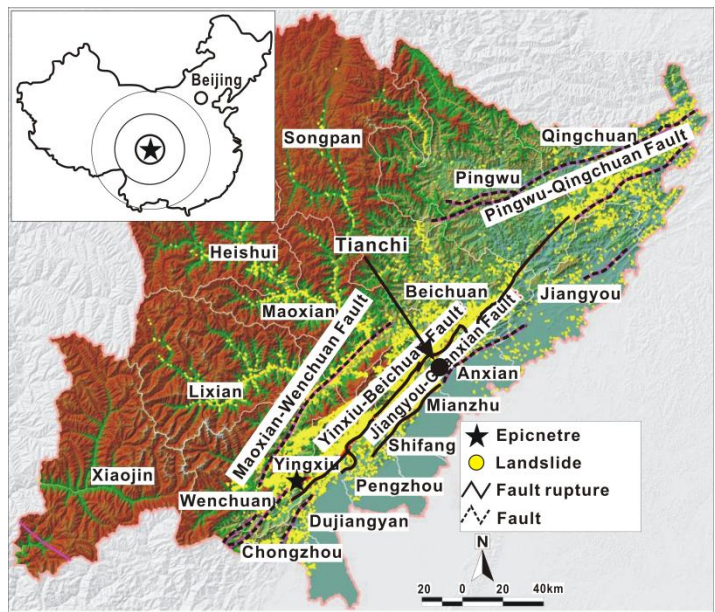


Fig. 1 Epicenter of Sichuan earthquake, distribution of landslides, and location of Tianchi landslide dam (after Huang and Li (2009)).



Fig. 2 Landslide dam in Tianchi area. (a) aerial photo of landslide area before the quake; (b) View of the landslide from the upper stream of the river after all construction has been finished (Taken on March 19, 2011); (c) Landslide dam and lake (Courtesy of F. Cai, taken on November 7, 2008 by F. Cai) viewing from upstream; (d):Landslide dam viewing from downstream (Courtesy of F. Cai, taken on November 7, 2008)

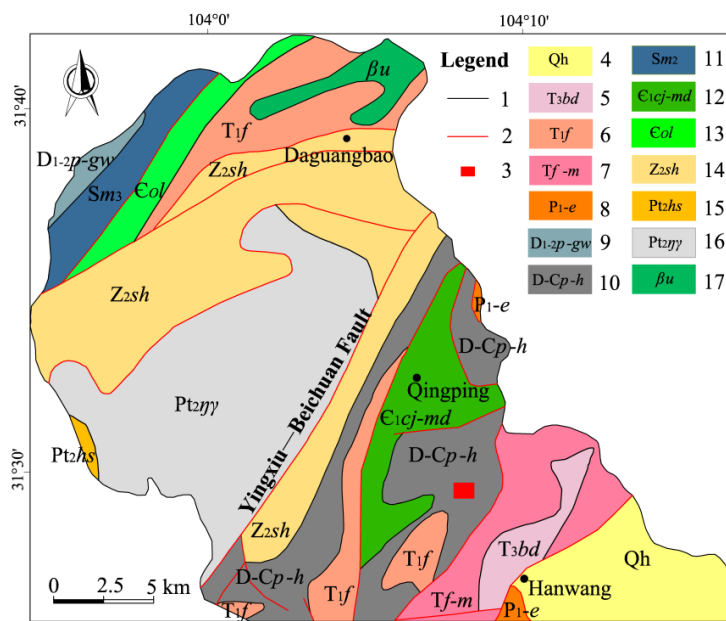


Fig. 3 Geological settings of Tianchi area (1: Stratum boundary; 2: Fault; 3: Tianchi landslide area; 4: Quaternary alluvial and diluvial deposit; 5: Triassic Sand, conglomerate, siltstone and mudstone; 6: Triassic shale; 7: Triassic clastic rock and carbonate rock; 8: Permian shale, limestone and basalt; 9: Devonian sandstone and conglomerate with carbonate rock; 10: Devonian clastic rock and carbonate rock; 11: Silurian slate; 12: Cambrian shale, siltstone, mudstone and sandstone; 13: Cambrian dolomite; 14: Sinian dolomite and marble; 15: Proterozoic acid volcanic, clastic rock and carbonate rock; 16: Proterozoic granite; 17: Diabase dike)(after Ma, 2002)

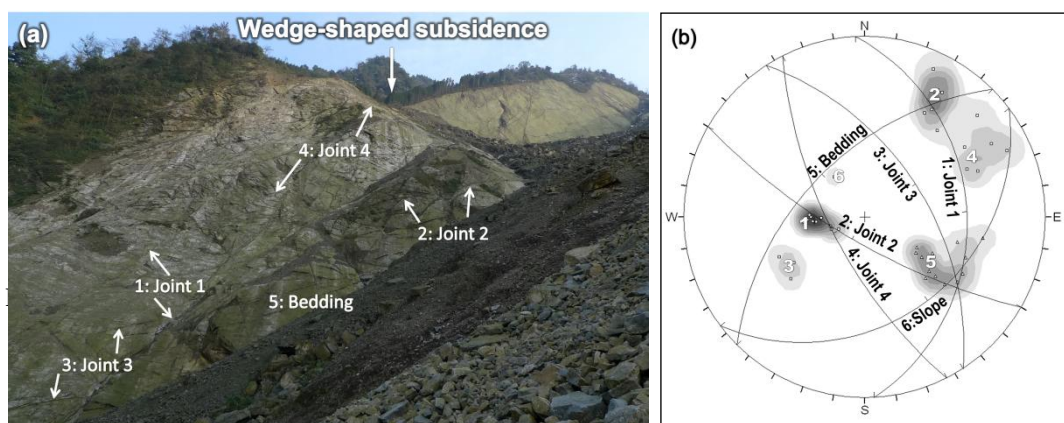


Fig. 4 (a): Source area of the landslide, (b): Stereonet graph of the discontinuities of rocks on the source area

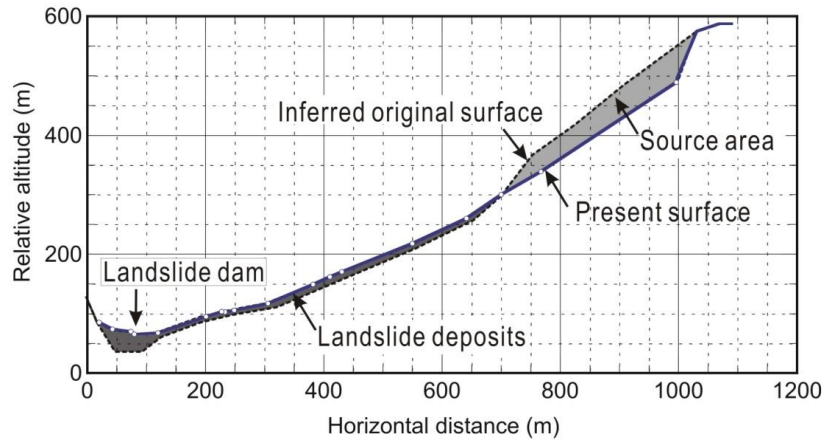


Fig. 5 Longitudinal section along line I-I' in Photo 2a

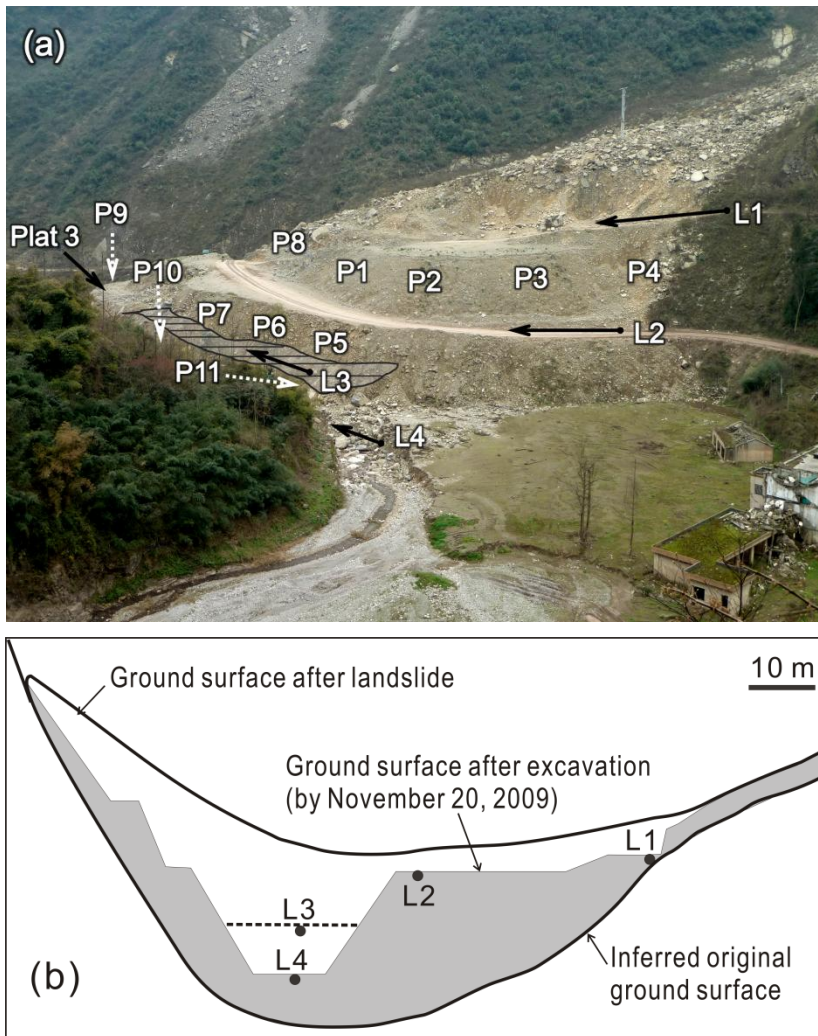


Fig. 6 (a) Photo of landslide dam after excavation with locations of S-wave survey lines and grain size analysis points (P1~P11); (b) Cross section of the landslide dam during differing surveying times. L3, L4: spillway levels on November 20, 2009, and June 16, 2010, respectively.

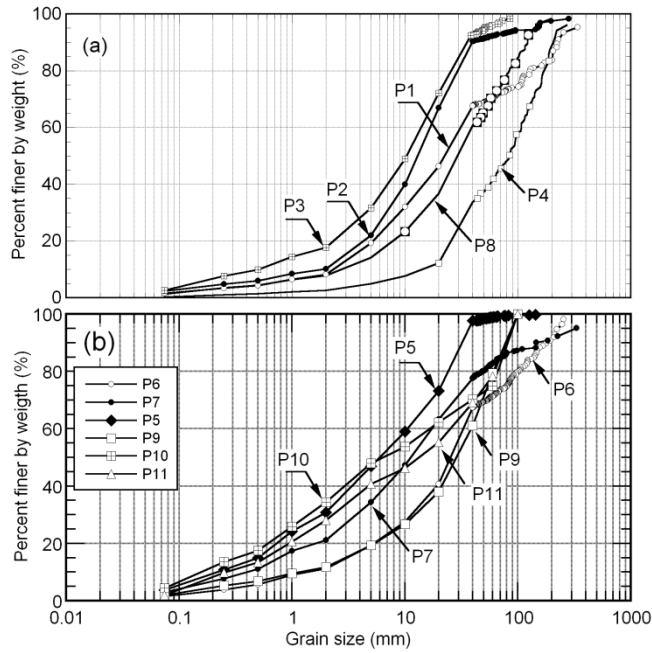


Fig. 7 Grain size distributions of materials from dam body. (a): samples on the same altitude level. (b): Samples at different depth of the dam body

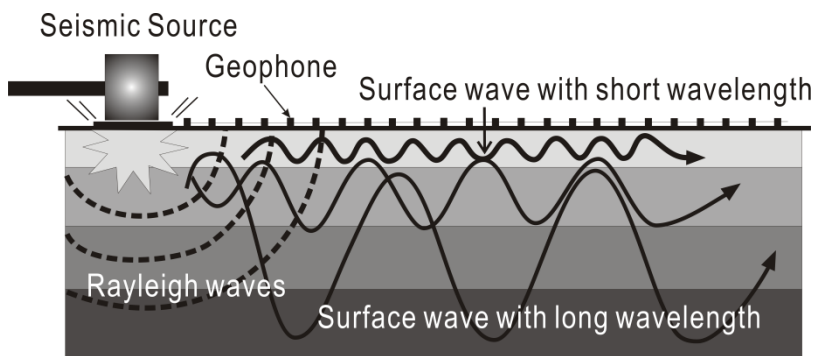


Fig. 8 Measurement principle of multichannel analysis of surface waves (MASW).

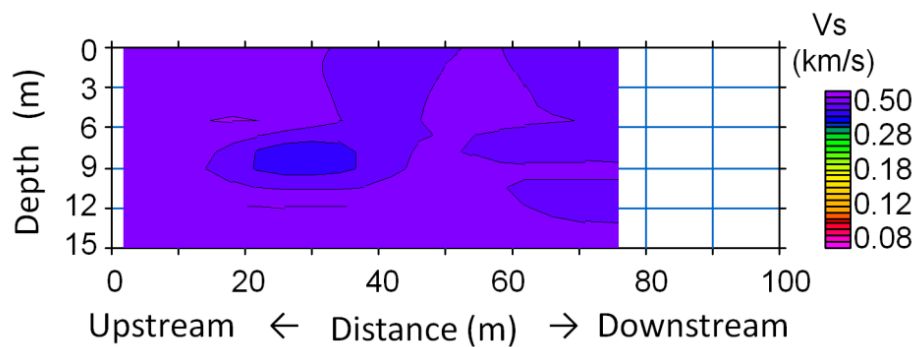


Fig. 9 Shear-wave velocity (V_s) profile along traverse line L1

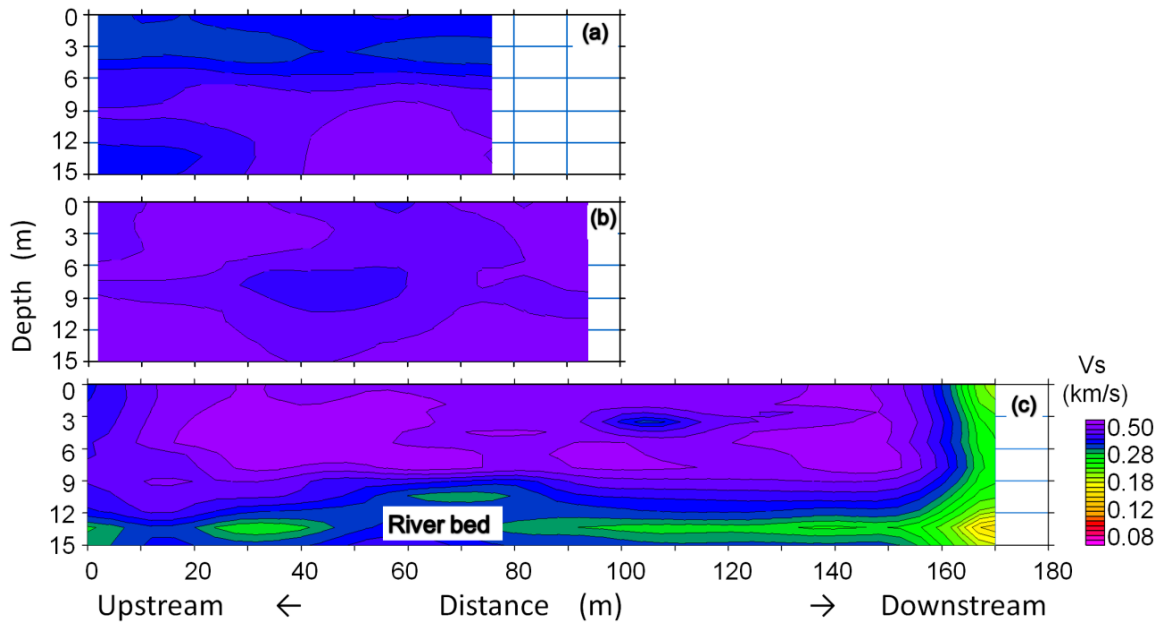


Fig. 10 Shear-wave velocity (V_s) profile of the dam body. (a), (b), (c): results for traverse line L2, L3 and L4, respectively

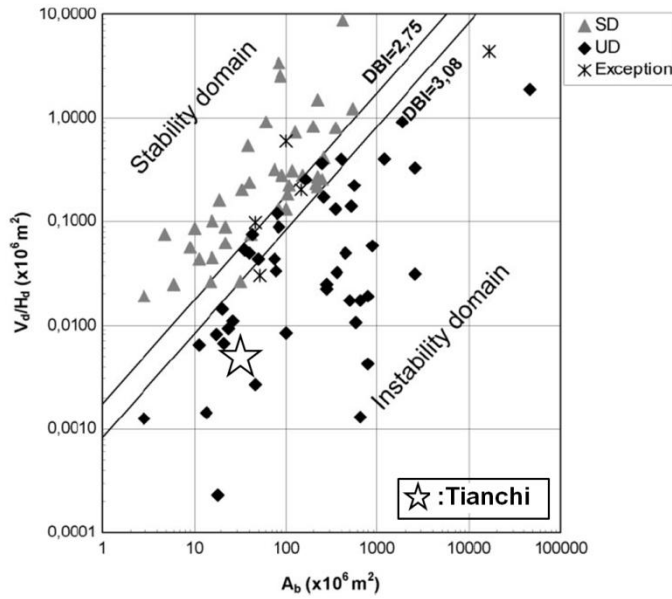


Fig.11 Stability analysis using Dimensionless Blockage Index (after Ermini and Casagli (2003)) $\blacktriangle$: intact landslide dams; $\blacklozenge$: collapsed landslide dams